


INSTALLER TO PROVIDE GROMMETS AT ALL FRAME PENETRATIONS WHERE POSSIBLE TO AVOID CABLE


2. INSTALLER TO LABEL IGU CABLES WITH IGU NAME TO WHICH IT IS CONNECTED.

DAMAGE.


- WHEN GLAZING POCKET CANNOT ACCOMMODATE IGU/SWC, INCORPORATE SERVICE LOOP INTO IGU CABLING. MAKE CONNECTION TO SWC AS YOU ARE GLAZING AND PUSH CONNECTOR THROUGH HOLE AND INTO MULLION.
- 4. NO WIRE ROUTING IN SILL.

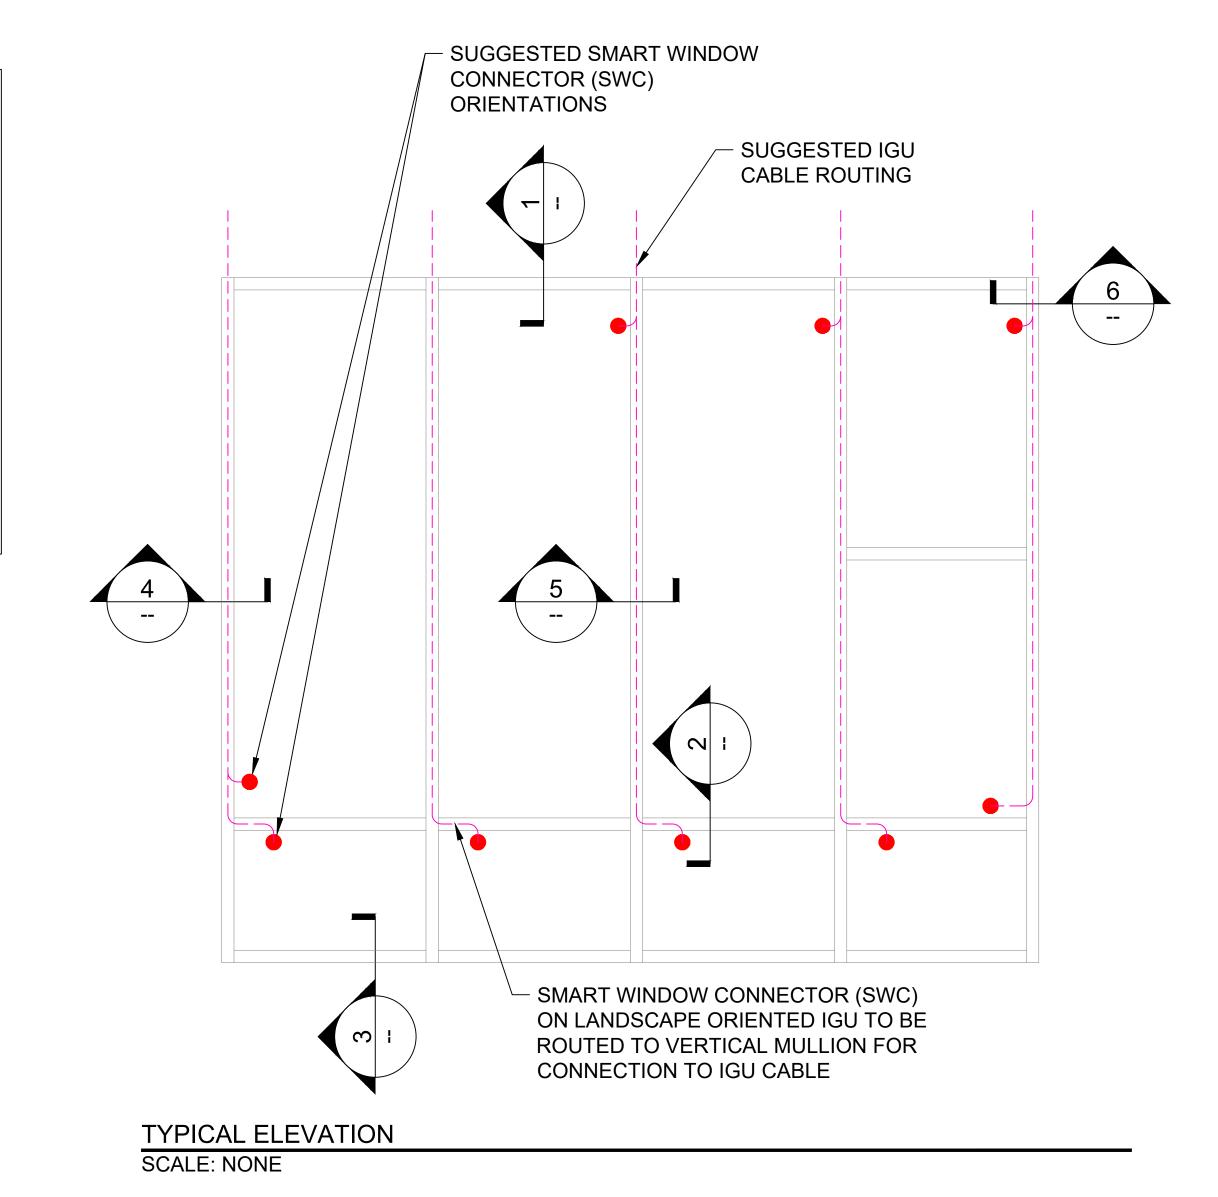

DETAIL 1 HEAD

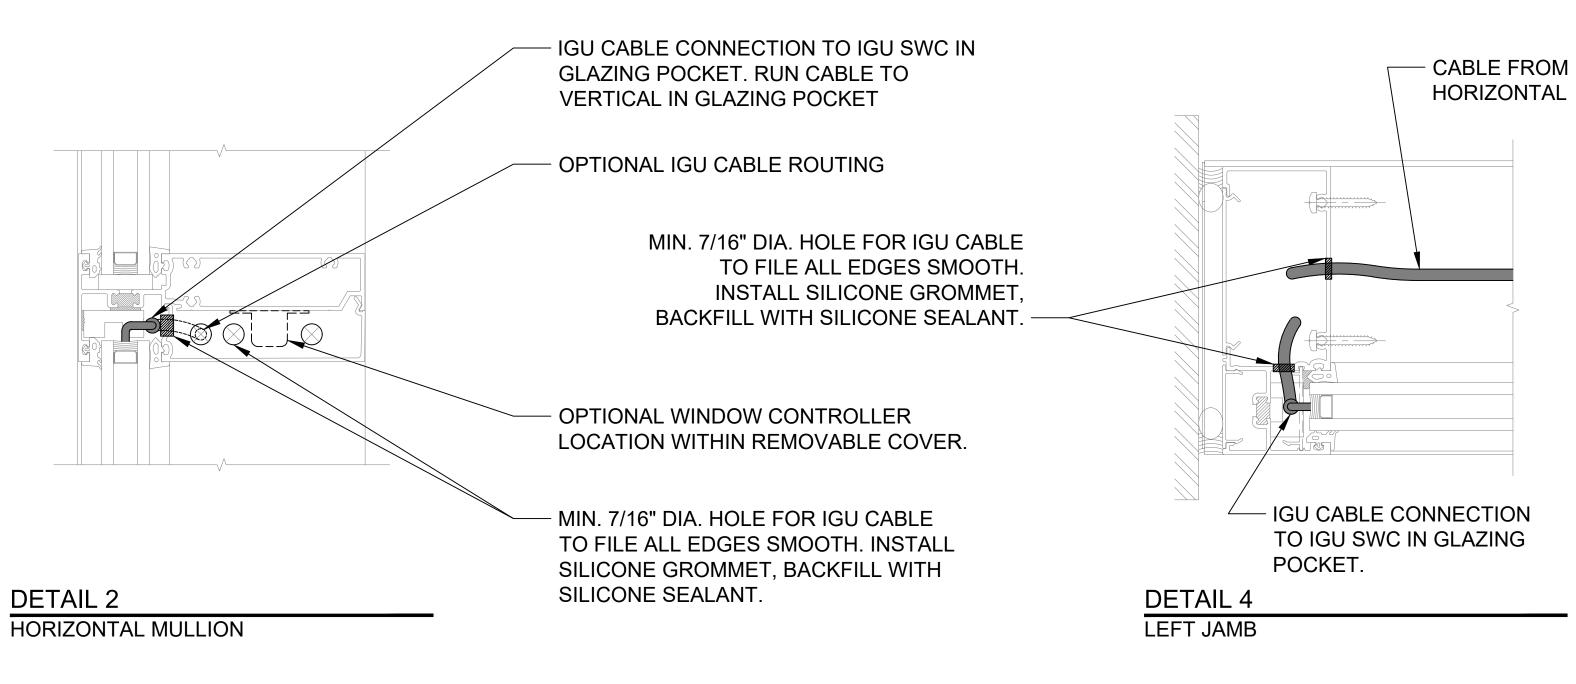



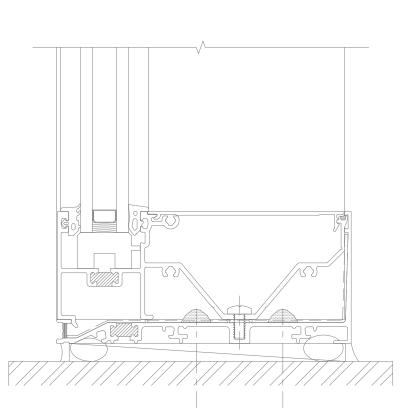

- MIN. 7/16" DIA. HOLE FOR IGU CABLE TO FILE ALL EDGES SMOOTH. INSTALL SILICONE GROMMET, BACKFILL WITH SILICONE SEALANT.

- CABLE FROM

HORIZONTAL

IGU CABLE CONNECTION TO IGU SWC IN VERTICAL MULLION. SERVICE LOOP TO BE INSTALLED FOR RE-GLAZING. -

DETAIL 3

DETAIL 5 VERTICAL MULLION

INSTALLATION DETAILS: FOR YWW 60 TU IG - WW

VIEW INC. CONFIDENTIAL: THIS DOCUMENT AND THE INFORMATION CONTAINED IN IT ARE CONFIDENTIAL, AND CANNOT BE COPIED OR DISCLOSED IN WHOLE OR IN PART WITHOUT THE EXPRESS WRITTEN CONSENT OF VIEW, INC.®

View

195 SOUTH MILPITAS BLVD.

MILPITAS, CA 95035

www.viewglass.com

v. 408/263.9200

VIEW, INC.®