

IGU CABLE CONNECTION TO IGU. SWC IN GLAZING POCKET. RUN CABLE TO VERTICAL IN GLAZING POCKET OPTIONAL IGU CABLE ROUTING


> MIN. 7/16" DIA. HOLE FOR IGU CABLE TO FILE ALL EDGES SMOOTH. INSTALL SILICONE GROMMET, BACKFILL WITH SILICONE SEALANT.



- INSTALLER TO PROVIDE GROMMETS AT ALL FRAME PENETRATIONS WHERE POSSIBLE TO AVOID CABLE DAMAGE.
- INSTALLER TO LABEL IGU CABLES WITH IGU NAME TO WHICH IT IS CONNECTED.

NOTES:

- WHEN GLAZING POCKET CANNOT ACCOMMODATE IGU/SWC, INCORPORATE SERVICE LOOP INTO IGU CABLING. MAKE CONNECTION TO SWC AS YOU ARE GLAZING AND PUSH CONNECTOR THROUGH HOLE AND INTO MULLION.
- NO WIRE ROUTING IN SILL.

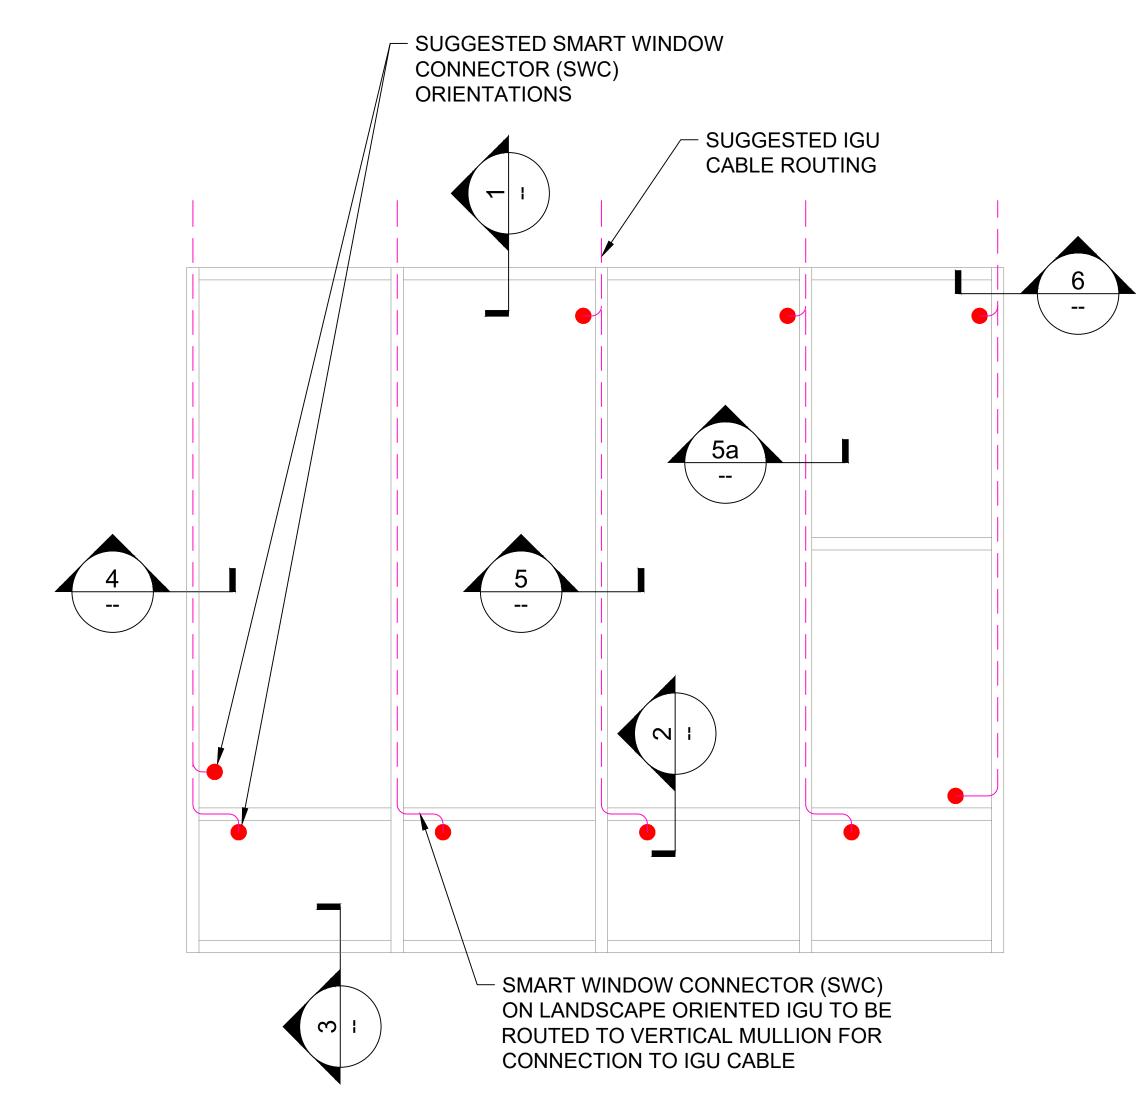

TYPICAL ELEVATION SCALE: NONE


DETAIL 2


DETAIL 3

DETAIL 1

HEAD


HORIZONTAL MULLION

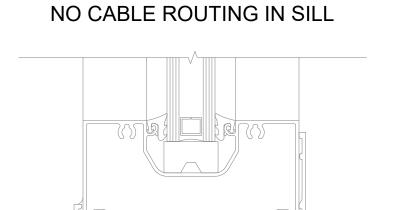

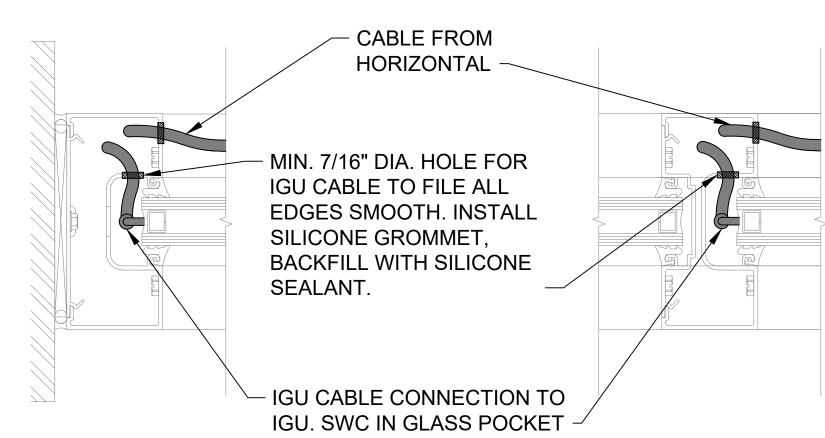

DETAIL 4 LEFT JAMB

DETAIL 5 VERTICAL MULLION

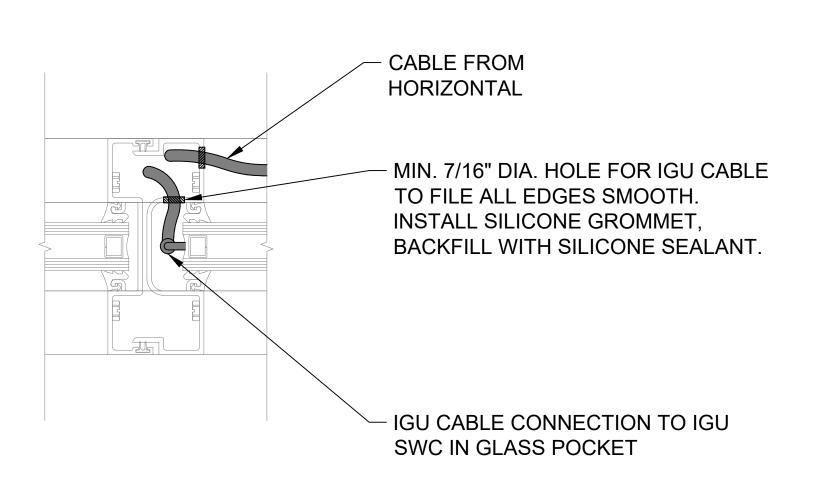

DETAIL 5A

VERTICAL EXPANSION MULLION

INSTALLATION DETAILS: FOR OLDCASTLE - FG3000-IG (SF)

VIEW INC. CONFIDENTIAL: THIS DOCUMENT AND THE INFORMATION CONTAINED IN IT ARE CONFIDENTIAL, AND CANNOT BE COPIED OR DISCLOSED IN WHOLE OR IN PART WITHOUT THE EXPRESS WRITTEN CONSENT OF VIEW, INC.®

view

195 SOUTH MILPITAS BLVD.

MILPITAS, CA 95035

www.viewglass.com

v. 408/263.9200

VIEW, INC.®

SCALE: 1:2