


DETAIL 1
HEAD

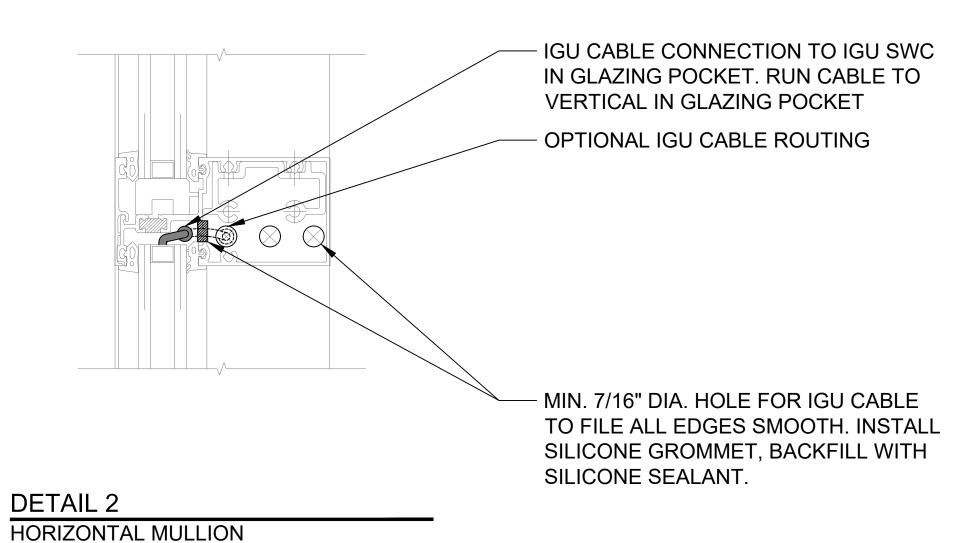


NOTES:

1. INSTALLER TO PROVIDE GROMMETS
AT ALL FRAME PENETRATIONS
WHERE POSSIBLE TO AVOID CABLE
DAMAGE.


2. INSTALLER TO LABEL IGU CABLES WITH IGU NAME TO WHICH IT IS CONNECTED.

WHEN GLAZING POCKET CANNOT ACCOMMODATE IGU/SWC, INCORPORATE SERVICE LOOP INTO IGU CABLING. MAKE CONNECTION TO SWC AS YOU ARE GLAZING AND PUSH CONNECTOR THROUGH HOLE AND INTO MULLION.


4. NO WIRE ROUTING IN SILL.

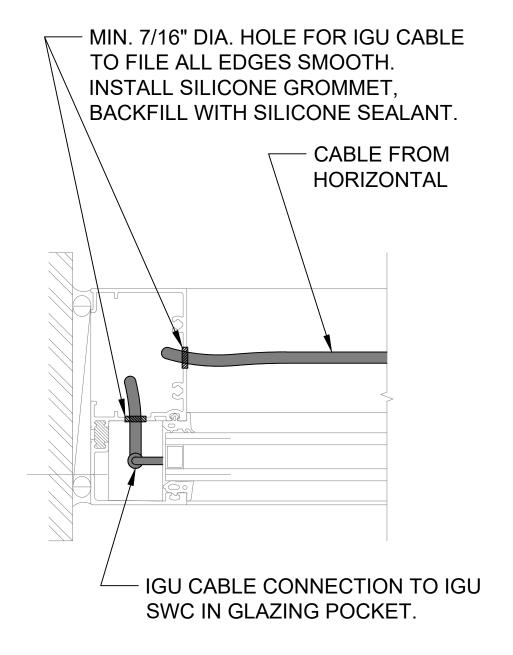


DETAIL 4 LEFT JAMB

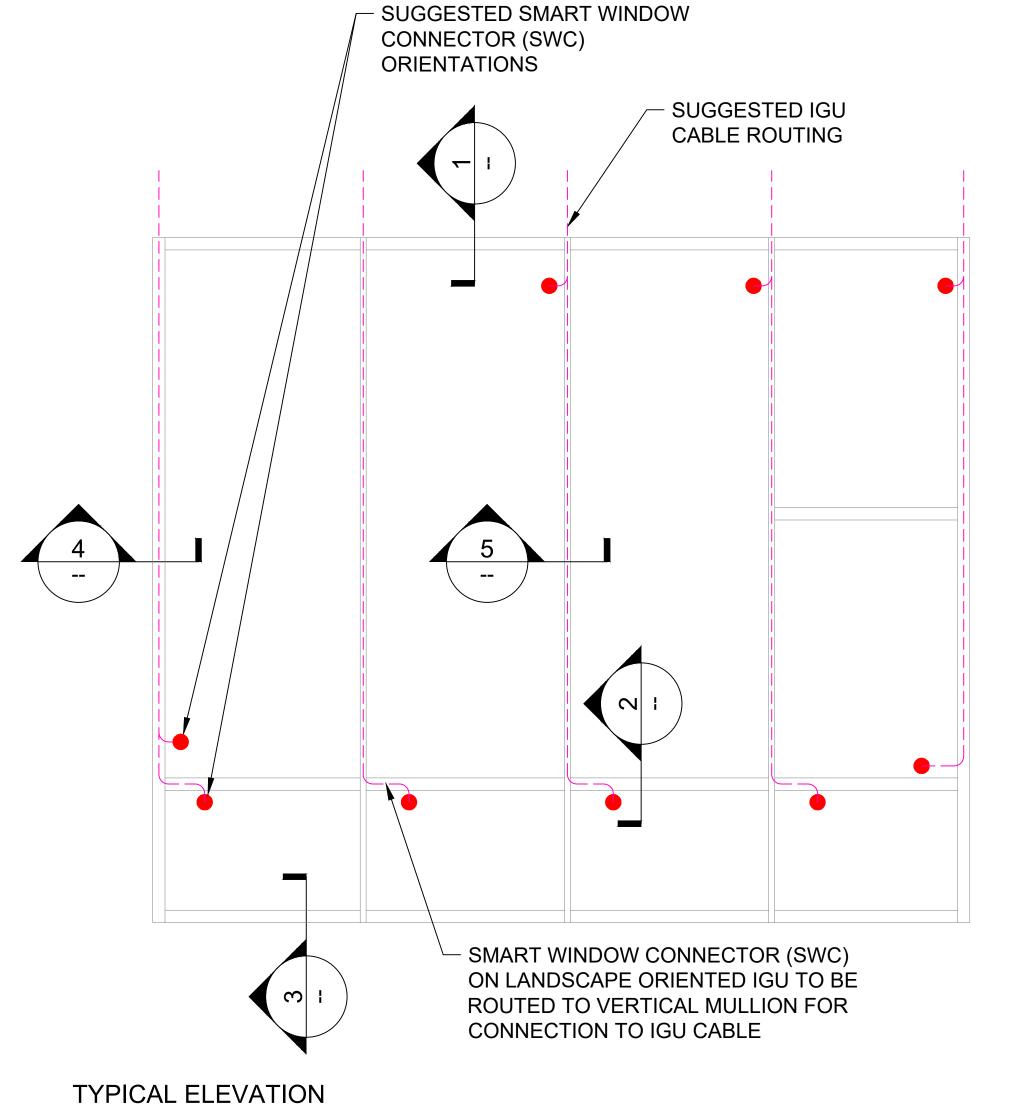

NO CABLE ROUTING IN SILL

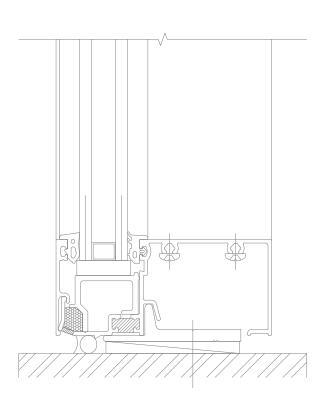

IGU CABLE CONNECTION TO IGU SWC IN VERTICAL MULLION. SERVICE LOOP TO BE INSTALLED FOR RE-GLAZING. –

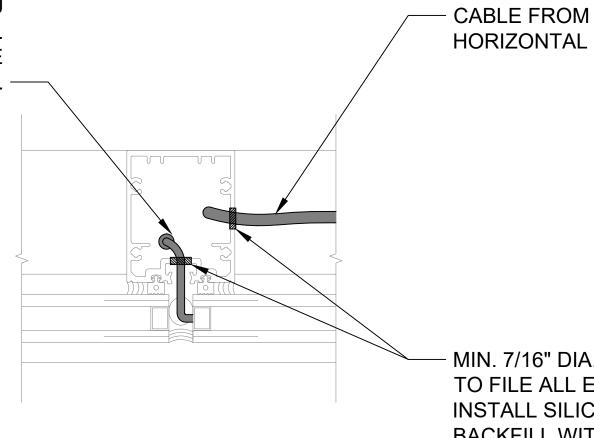

MIN. 7/16" DIA. HOLE FOR IGU CABLE
 TO FILE ALL EDGES SMOOTH.
 INSTALL SILICONE GROMMET,
 BACKFILL WITH SILICONE SEALANT.

SCALE: NONE

DETAIL 3

DETAIL 5
VERTICAL MULLION

_

INSTALLATION DETAILS: FOR YWW 45 TU SSG OG - WW

VIEW INC. CONFIDENTIAL: THIS DOCUMENT AND THE INFORMATION CONTAINED IN IT ARE CONFIDENTIAL, AND CANNOT BE COPIED OR DISCLOSED IN WHOLE OR IN PART WITHOUT THE EXPRESS WRITTEN CONSENT OF VIEW, INC.®

view

195 SOUTH MILPITAS BLVD.

MILPITAS, CA 95035

www.viewglass.com

v. 408/263.9200

VIEW, INC.®

SCALE: 1:2

ATE: February 9, 2020